

# AECOM

## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	1 of 10

### Weather Conditions

Conditions: Daylight hours: Rainy/overcast. Winds variable 0-3 mph.  
 Temperature (°F): High 81°F Low 57°F

Contractors & Subcontractors Workforce				Equipment in Use			
Trade	#	x	hrs	Trade	#	X	Hrs
USACE				Ludlow Construction			
Field Engineer	1	x	8	Superintendent	1	X	8
				Safety Officer	1	X	8
				Foreman	0	X	8
				Dump truck Operator	1	X	8
				Excavator Operator	1	X	8
				Skid Steer/ Bucket Loader	1	X	8
				Laborers	3	X	8
JTC	0	x	8	Note that some persons			
Fazzino Plumbing	0	x	8	Multiple pieces equipment.			
A&R Electrical	0	x	8				
CT Traffic Control	0	x	8	Sub-contractor	0	X	8
DN Tanks	0	x	8	Municipal Police Detail	0	X	8
				State Police Detail	0	X	8

Visitors: None.

### Pipe Connections, Installations, and Other Work

Ludlow continued with the installation of a 1.5" copper water service lines at the residence located at 10 Johns Way, Durham and installed a 1" copper water service line at 29 Maple Avenue, Durham. Fazzino Plumbing and Heating, Inc. installed final water service to the building at 280 Main Street, Durham. Laydon placed asphalt curbing on Main Street, Durham.

### Daily Activities – Installation of water lines, Durham

Ludlow continued with the installation of a 1.5" copper water service lines at the residence located at 10 Johns Way, Durham and installed a 1" copper water service line at 29 Maple Avenue, Durham.

0711: Ludlow has returned to the residence at 10 Johns Way, Durham, to restore the sections of the lawn that were disturbed during the installation of a 1.5" copper water service line on Friday.

0751: Ludlow continues with property restoration activities at the 10 Johns Way residence.

0908: Ludlow continues with property restoration activities at the 10 Johns Way residence.

<b>Res. Representative:</b>	J. Meunier	<b>Date:</b>	08/16/21
-----------------------------	------------	--------------	----------

## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	2 of 10

1021: Ludlow continues with property restoration activities at the 10 Johns Way, Durham residence.

1109: Ludlow has finished with water service line installation activities at the 10 Johns Way residence.

1210: Ludlow continues with property restoration activities at the 10 Johns Way residence.

1249: Ludlow begins excavating at the 29 Maple Avenue on the south side of the house.

1251: Ludlow continues to place grass seed at the 10 Johns Way, Durham, property.

1300: Ludlow is preparing to drill through the south side of the foundation of the 29 Maple Avenue residence from the inside of the house with a rotary hammer.

1307: Ludlow is preparing to slide 1" copper water service line through the block foundation on the southside of 29 Maple Avenue.

1312: While excavating for the installation of a 1" copper water service line, Ludlow breaks a 4" plastic PVC drain line located 2' below surface grade that is located about 5' north of the curb stop for 29 Maple Avenue.

1336: The penetration through the southern foundation of the 29 Maple Avenue residence is located 36.0" west of the southeast corner of the house.

1347: Ludlow has connected a 1" copper water service line to the curb stop and has run it into the 29 Maple Avenue residence. Ludlow is covering the copper pipe with a layer of sand followed by caution tape.

1441: Ludlow has the trench they excavated at the 29 Maple Street residence backfield with native soil placed and compacted in 1' lifts. Ludlow is placing and raking loam and preparing to place grass seed over the disturbed areas that they repaired.

### Daily Activities – Full water service installation activities, Main Street, Durham

Fazzino Plumbing and Heating, Inc. installed final water service to the building at 280 Main Street, Durham.

0934: Fazzino Plumbing is installing final water service components at the 280 Main Street building. The components are being placed on the south wall of the building's foundation.

1036: Fazzino Plumbing continues to work at 280 Main Street, Durham, building installing final water service components.

1125: Fazzino Plumbing has finished installing final water service components at the 280 Main Street, Durham. Fazzino is has finished installation activities for the day.

### Daily Activities – Miscellaneous road work, Main Street, Durham

Laydon placed asphalt curbing on Main Street, Durham.

<b>Res. Representative:</b>	J. Meunier	<b>Date:</b>	08/16/21
-----------------------------	------------	--------------	----------

# AECOM

## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	3 of 10

0701: Eversource contractors have painted traffic lines on Main Street in Durham and the portion of S. Main Street in Middletown and a portion of Route 68.

0922: Laydon is placing asphalt curbing at Station 152+50 on the southbound lane of Main Street.

1006: Laydon is placing asphalt curbing at Station 150+00 on the southbound lane of Main Street in Durham.

**Res. Representative:**

J. Meunier

**Date:** 08/16/21

## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	4 of 10



**Picture 1: Ludlow delivering loam to the 10 Johns Way property as they restore the areas disturbed during the installation of a 1.5" copper water service line. View to the west.**

**Res. Representative:**

J. Meunier

**Date:** 08/16/21

## Daily Report


<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	5 of 10



**Picture 2: Ludlow raking out loam at the 10 Johns Way property as they restore the areas disturbed during the installation of a 1.5" copper water service line. View to the northwest.**

## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	6 of 10

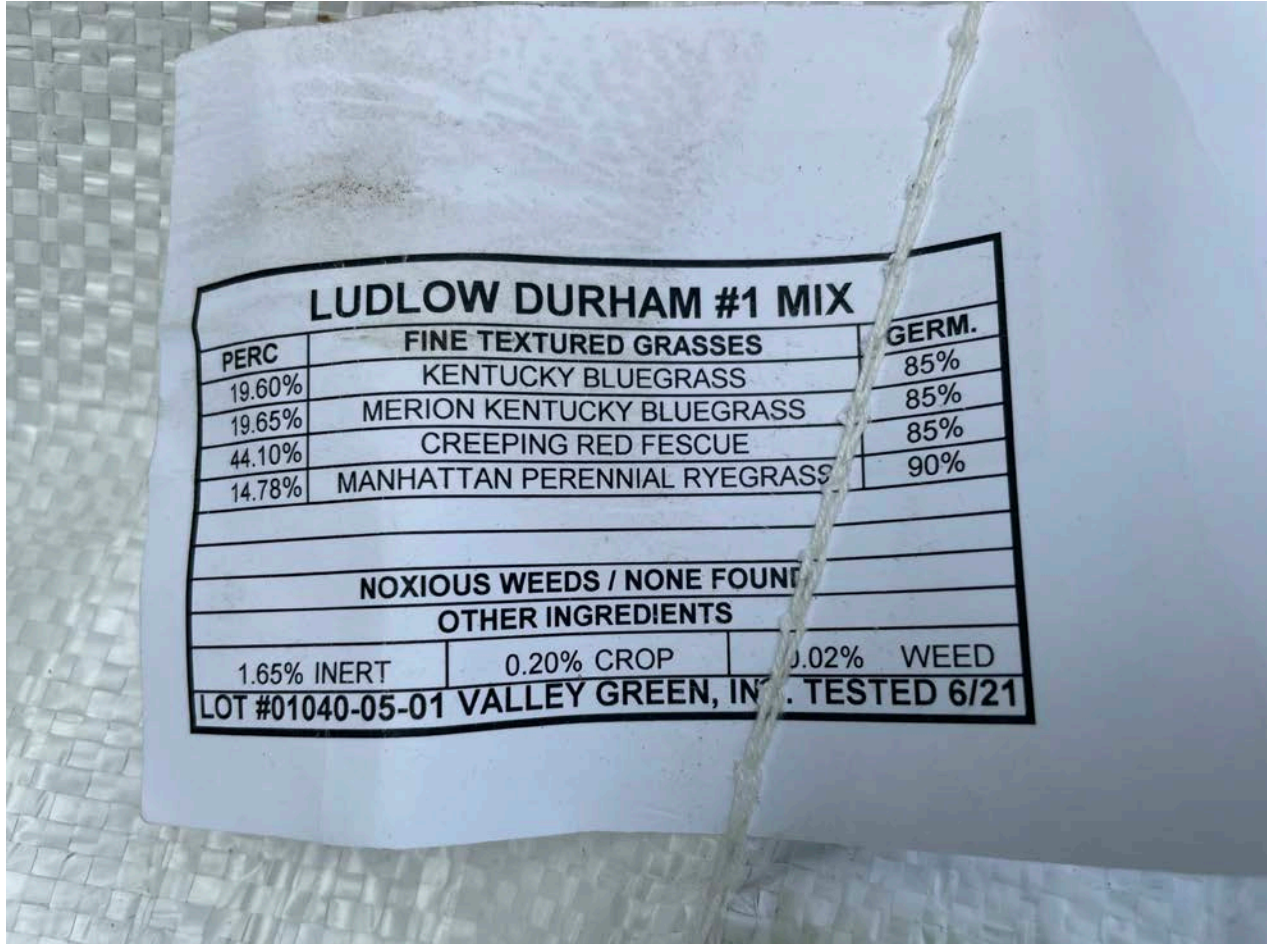

Picture 3: Grass seed mix that Ludlow is using when restoring areas disturbed during the installation of copper water service lines.

<b>Res. Representative:</b>	J. Meunier	<b>Date:</b>	08/16/21
-----------------------------	------------	--------------	----------

## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	7 of 10



Picture 4: Ludlow excavating on the south side of the residence located at 29 Maple Avenue, Durham as they prepare to install a 1" copper water service line. View to the west.

## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	8 of 10



**Picture 5: Ludlow excavating to the south side of the residence located at 29 Maple Avenue, Durham as they prepare to install a 1" copper water service line. View to the west.**

<b>Res. Representative:</b>	<u>J. Meunier</u>	<b>Date:</b>	<u>08/16/21</u>
-----------------------------	-------------------	--------------	-----------------



## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	9 of 10



**Picture 6: Ludlow compacting backfill with a jumping jack after having installed a 1" copper water service line at the 29 Maple Avenue residence. View to the northwest.**

**Res. Representative:**

J. Meunier

**Date:** 08/16/21

## Daily Report

<b>Project:</b>	Durham Meadows Pipeline Installation	<b>Date:</b>	August 16, 2021
<b>Location:</b>	Johns Way and Maple Avenue, Durham; S. Main Street, Middletown	<b>Day of Week:</b>	Monday
<b>Project #:</b>	AECOM: 6061487	<b>Report No:</b>	303
<b>Contractor:</b>	Ludlow Construction	<b>Page:</b>	10 of 10



Picture 7: Final water service components that Fazzino Plumbing installed today at the residence located at 280 Main Street, Durham. View to the south.

Res. Representative:

J. Meunier

Date: 08/16/21