

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	1 of 14

Weather Conditions

Conditions: Daylight hours: Mostly sunny. Wind variable 0-11 mph.
 Temperature (°F): High 73°F Low 52°F

Contractors & Subcontractors Workforce				Equipment in Use			
Trade	#	x	hrs	Trade	#	X	hrs
USACE				Ludlow Construction			
Field Engineer	1	x	8	Superintendent	0	X	8
				Safety Officer	0	X	8
				Foreman	1	X	8
				Dump truck Operator	0	X	8
John Turner Consulting	0	x	8	Excavator Operator	1	X	8
Grela Well Drilling	0	x	8	Skid Steer/Bucket Loader	0	X	8
Fazzino Plumbing	2	x	8	Laborers	2	X	8
United Concrete	0	x	8	Note that some persons operate			
Knapp Engineering	1	x	8	Multiple pieces equipment.			
Apuzzo Electric	2	x	8				
Harper Haines	0	x	8	Sub-contractor	5	X	8
A&R Electrical	0	x	8	Municipal Police Detail	0	X	8
				State Police Detail	0	X	8

Visitors: None.

Pipe Connections, Installations, and Other Work

Ludlow placed asphalt around 4 catch basins located on the Shared Access Driveway in Middletown and between the driveways of the 214 and 216 Talcott Ridge Drive properties and restored the area between the two driveways with loam and grass seed. Ludlow has placed, graded, and reseeded loam on the east side of the Booster Station located on S. Main Street in Middletown, and performed earth work to prepare for an upcoming paving event. Fazzino Plumbing continued plumbing work associated with the installation of a chlorination system in the Long Hill Pump Station on Long Hill Road in Middletown. A&R Electrical installed 1" steel conduit inside of the PRV Vault located at Station 161+40 on Main Street in Durham. Knapp Engineering worked at the Water Meter Building located at Station 124+80 on S. Main Street in Middletown and the electrical enclosure located east of the Shared Access Driveway in Middletown.

Daily Activities – Shared Access Driveway, Middletown

Ludlow placed asphalt around 4 catch basins located on the Shared Access Driveway in Middletown and between the driveways of the 214 and 216 Talcott Ridge Drive properties and restored the area between the two driveways with loam and grass seed.

Res. Representative:	J. Meunier	Date:	5/17/22
-----------------------------	------------	--------------	---------

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	2 of 14

0733: Ludlow is placing asphalt around one of the four catch basins on the Shared Access Driveway that they recent raised the elevation. Ludlow paved and performed lawn restoration where the driveways for 214 and 216 Talcott Ridge Drive intersect with the Shared Access Driveway.

0829: Ludlow continues to place asphalt around the 4 catch basins located between Stations 13+00 and 14+34 on the Shared Access Driveway.

0959: Ludlow has placed asphalt around the 4 catch basins located between Stations 13+00 and 14+34 on the Shared Access Driveway. In addition, Ludlow has placed a ~16"-wide strip of asphalt on the north side of the peninsula that separates the driveways of the 214 and 216 Talcott Ridge Drive properties and has restored the remainder of the peninsula with loam and grass seed.

Daily Activities – Booster Station, S. Main Street, Middletown

Ludlow has placed, graded, and reseeded loam on the east side of the Booster Station located on S. Main Street in Middletown, and performed earth work to prepare for an upcoming paving event.

1026: Ludlow has finished working on the Shared Access Driveway and is in the process of mobilizing to the Booster Station located on S. Main Street in Middletown.

1044: Ludlow is placing, grading, and reseeded loam on the east side of the Booster Station near its southeast corner.

1124: Ludlow is placing, grading, and reseeded loam on the east side of the Booster Station near its southeast corner.

1206: Ludlow is excavating soil on the west side of the Booster Station and the concrete pad for the generator. This area will be backfilled with -3" gravel and compacted in preparation for paving.

1233: Ludlow continues to rake and seed the loam they placed on the south and southeast side of the Booster Station. Ludlow is also backfilling around the concrete generator pad located on the west side of the Booster Station using -3" gravel.

1307: Ludlow continues to grade and compact the fill they placed around the concrete generator pad located on the west side of the Booster Station. Ludlow is also using a rolling compactor on the fill located to the north of the Booster Station.

1429: Ludlow is establishing grade and is continuing earthwork for the upcoming paving at the Booster Station.

Daily Activities – Long Hill pump station, Long Hill Road, Middletown

Fazzino Plumbing continued plumbing work associated with the installation of a chlorination system in the Long Hill Pump Station on Long Hill Road in Middletown.

0745: Fazzino Plumbing has mobilized to the Long Hill Pump Station to work on plumbing associated with the chlorination system that is being installed in the southeast corner of the building.

Res. Representative:	J. Meunier	Date:	5/17/22
-----------------------------	------------	--------------	---------

AECOM

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	3 of 14

0902: Fazzino Plumbing continues to work on plumbing associated with the chlorination system that is being installed at the Long Hill Pump Station.

1337: Fazzino Plumbing continues work associated with the installation of a chlorination system at the Long Hill Pump Station.

Daily Activities – Miscellaneous

- A&R Electrical installed 1" steel conduit inside of the PRV Vault located at Station 161+40 on Main Street in Durham.
- Knapp Engineering worked at the Water Meter Building located at Station 124+80 on S. Main Street in Middletown.
- Knapp Engineering worked at the electrical enclosure located east of the Shared Access Driveway in Middletown.

Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	4 of 14



Picture 1: View of the peninsula of land located between the driveways for the 214 and 216 Talcott Ridge Drive properties where Ludlow excavated soil and placed additional asphalt. Shared Access Driveway in Middletown; view to the northwest.

Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	5 of 14



Picture 2: Catch basin located at ~Station 13+70 on the north side of the Shared Access Driveway where Ludlow placed asphalt. View to the northeast.

Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	6 of 14



Picture 3: Transition between the driveway for the 224 Talcott Ridge Drive property and the Shared Access Driveway where Ludlow saw cut ahead of placing the final lift of asphalt. View to the east.

Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	7 of 14



Picture 4: View of the peninsula of land located between the driveways for the 214 and 216 Talcott Ridge Drive properties where Ludlow placed additional asphalt and restored the land to the west with loam, grass seed, and straw. Shared Access Driveway in Middletown; view to the northwest.

Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	8 of 14



Picture 5: A&R Electrical installing 1" steel conduit on the inside of the PRV Vault located at Station 161+40 on Main Street, Durham. View to the northwest.

Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	9 of 14



Picture 6: The west side of the Booster Station where Ludlow has removed fill from around the concrete base of the generator in order to backfill it with -3" gravel prior to paving. View to the east.

Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	10 of 14



Picture 7: Ludlow placing grass see over freshly placed and raked loam on the southeast corner of the Booster Station. View to the southwest.

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	11 of 14



Picture 8: Ludlow placing -3" gravel around the concrete base of the generator located on the west side of the Booster Station. View to the northeast.

Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	12 of 14



Picture 9: Ludlow compacting the fill on the north side of the Booster Station prior to paving. S. Main Street, Middletown; view to the northwest.

Res. Representative:	<u>J. Meunier</u>	Date:	<u>5/17/22</u>
-----------------------------	-------------------	--------------	----------------

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	13 of 14



Picture 10: Ludlow grading the fill to the west of the Booster Station prior to paving. S. Main Street, Middletown; view to the west.


Res. Representative:

J. Meunier

Date: 5/17/22

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	May 17, 2022
Location:	Main Street, Durham; S. Main Street, Long Hill Road and the Shared Access Driveway, Middletown	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	427
Contractor:	Ludlow Construction	Page:	14 of 14

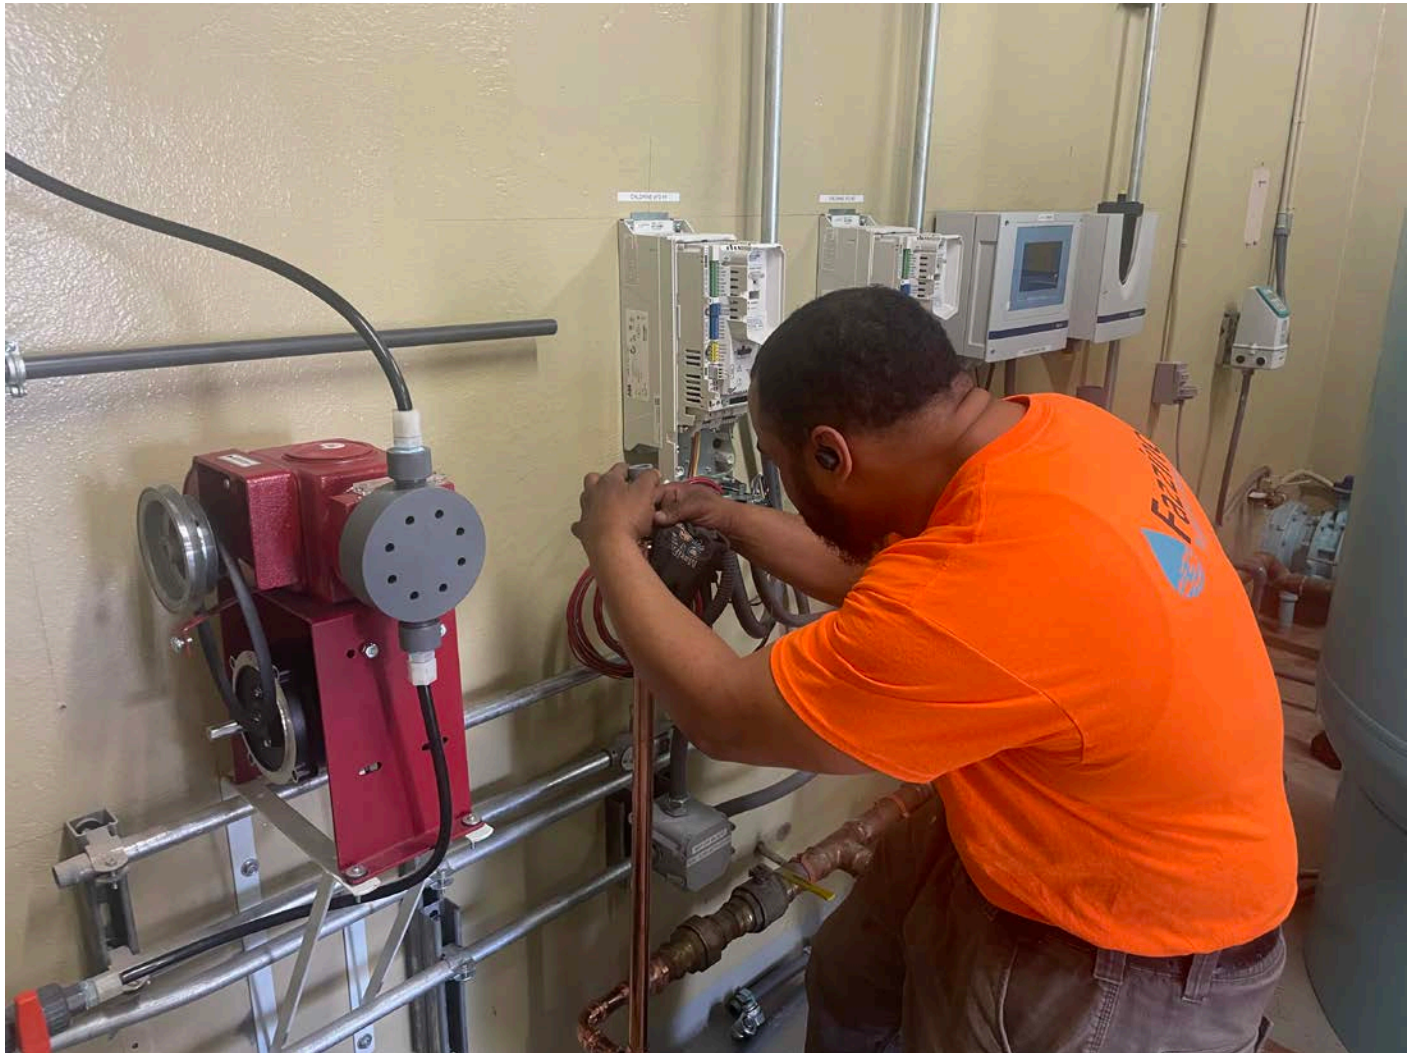

Picture 11: Fazzino Plumbing working on the installation of a chlorination system at the Long Hill Pump Station located on Long Hill Road in Middletown. View to the southwest.

Res. Representative:

J. Meunier

Date: 5/17/22