

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	1 of 9

Weather Conditions			
Conditions:	Daylight hours: Cloudy/rain. Wind variable 0-1 mph.		
Temperature (°F):	High 63°F	Low	63°F

Contractors & Subcontractors Workforce				Equipment in Use			
Trade	#	x	hrs	Trade	#	X	hrs
USACE				Ludlow Construction			
Field Engineer	1	x	8	Superintendent	0	X	8
				Safety Officer	0	X	8
Flow Tech	0	x	8	Foreman	1	X	8
Matt Chlor	0	x	8	Dump truck Operator	0	X	8
A&J Construction	0	x	8	Excavator Operator	1	X	8
Grela Well Drilling	0	X	8	Skid Steer/Bucket Loader	0	X	8
Fazzino Plumbing	0	X	8	Laborers	2	X	8
United Concrete	0	x	8	Note that some persons operate			
Knapp Engineering	0	x	8	Multiple pieces equipment.			
Apuzzo Electric	0	x	8				
Alarm Systems, Inc.	0	x	8	Sub-contractor	2	X	8
A&R Electrical	0	x	8	Municipal Police Detail	0	X	8
				State Police Detail	0	X	8

Visitors: None.

Pipe Connections, Installations, and Other Work

Ludlow continued the installation of a 2" copper water service line at the 114 Maiden Lane, Durham, property.

Daily Activities – installation of water lines, Durham

Ludlow continued the installation of a 2" copper water service line at the 114 Maiden Lane, Durham, property.

0700: Ludlow mobilizes back to the 114 Maiden Lane, Durham, property to resume the installation of a 2" copper water service line.

0724: Ludlow is trimming the brush located on the west side of the 114 Maiden Lane driveway. Ludlow has started excavating on the west side of the 114 Middle Lane driveway next to where it intersects with Maiden Lane.

0739: Ludlow has daylighted the 114 Maiden Lane curb stop with an excavator as they prepare to install 2" copper water service line.

0812: Ludlow is in the process of installing a meter vault approximately 10' north of the 114 Maiden Lane curb stop.

Res. Representative:	J. Meunier	Date:	6/28/22
-----------------------------	------------	--------------	---------

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	2 of 9

0834: Ludlow is placing sand beneath and on top of the 2" copper water service line they are installing on the west side of the 114 Maiden Lane driveway.

0914: Ludlow continues to excavate north of the meter pit they just installed on the west side of the 114 Maiden Lane driveway. A small amount of water (1"-3") is visible in some parts of the trench that Ludlow is excavating for the installation of a 2" copper water service line. Ludlow is placing sand above and below the pipe as they install it, and placing caution tape over the sand. Ludlow is backfilling over the sand with native material.

1002: Ludlow continues to excavate a trench on the west side of the 114 Maiden Lane driveway as they continue to install a 2" copper water service line, working northwards towards the Ball Brook culvert. Ludlow has installed the 2" copper pipe within 50' south of the culvert.

1133: Ludlow has almost finished grading the section of the driveway they disturbed while installing a 2" copper water service line at the 114 Maiden Lane property. Ludlow is cleaning the section of Maiden Lane located in front of the 114 Maiden Lane driveway with Broce Broom.

1221: Ludlow has begun to mobilize large sandbags to the Ball Brook culvert, where they plan to reroute the stream flow tomorrow when they make a second attempt to run 2" copper water service line beneath the culvert.

1256: Ludlow has placed 1.5" minus gravel as they continue to grade the 114 Maiden Lane driveway. Ludlow is also continuing to trim brush on the west side of the driveway between Maiden Lane and the Ball Brook culvert.

1332: Ludlow is finishing up grading the driveway at the 114 Maiden Lane property.

1406: Ludlow is working at the northwest corner of the 114 Maiden Lane residence, restoring the portions of the lawn that were disturbed during the installation of a 2" copper water service line. Ludlow is placing loam and grass seed.

Res. Representative:	J. Meunier	Date:	6/28/22
-----------------------------	------------	--------------	---------

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	3 of 9



Picture 1: Ludlow excavating on the west side of the 114 Maiden Lane, Durham, driveway next to Maiden Lane as they continue to install a 2" copper water service line. View to the west.

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	4 of 9



Picture 2: Ludlow installing 2" copper water service line on the west side of the 114 Maiden Lane, Durham, driveway. Note the meter vault located in the foreground on the right that Ludlow is in the process of installing. View to the southwest.

Daily Report


Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	5 of 9



Picture 3: Ludlow installing 2" copper water service line on the west side of the 114 Maiden Lane, Durham, driveway. View to the south.

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	6 of 9

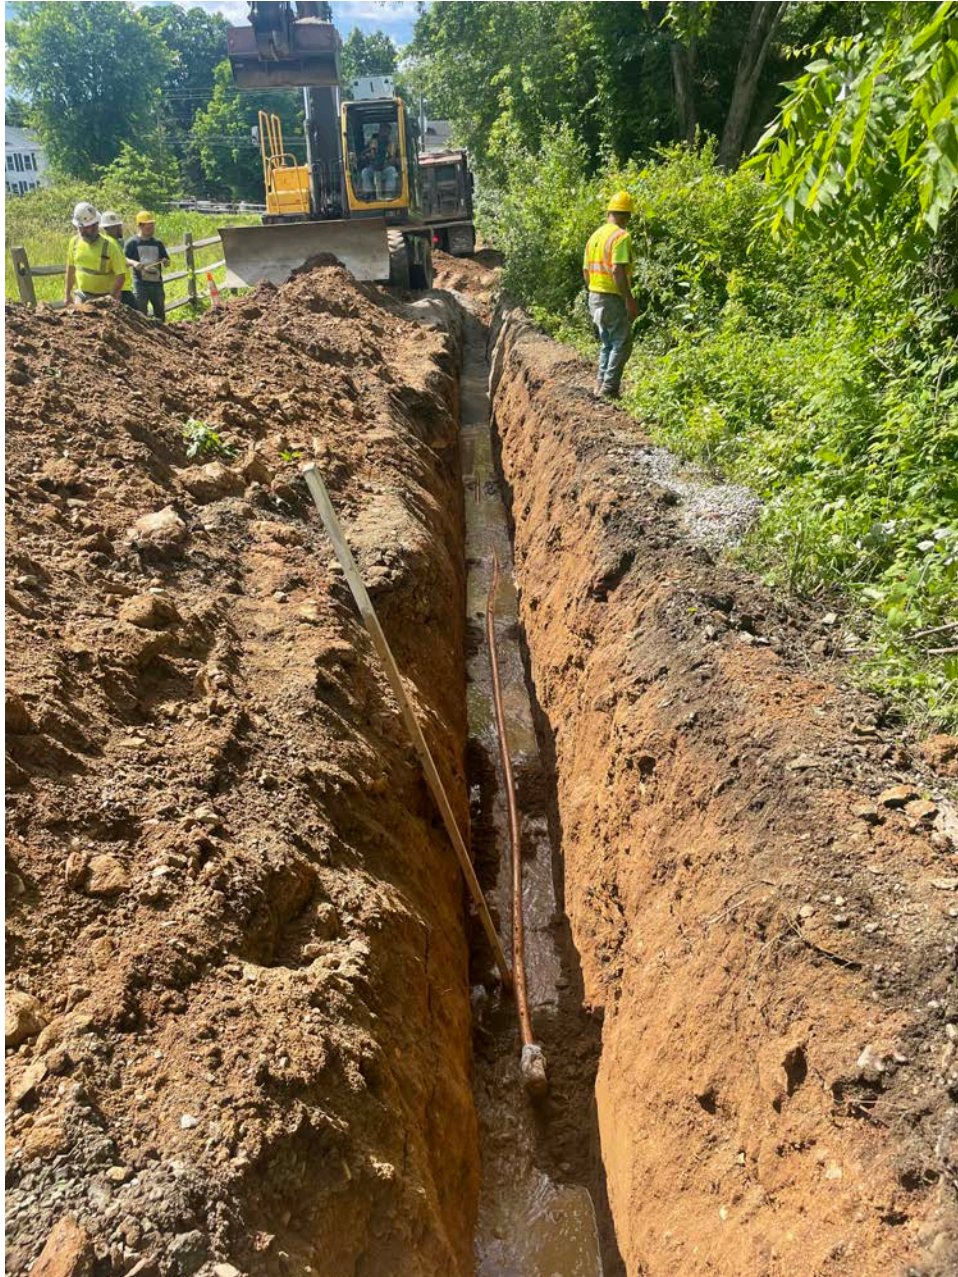

Picture 4: 2" copper water service line that Ludlow is in the process of installing on the west side of the 114 Maiden Lane, Durham, driveway. View to the south.

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	7 of 9



Picture 5: Sand and caution tape that Ludlow has placed over the 2" copper water service line that they have installed on the west side of the 114 Maiden Lane, Durham, driveway. View to the south.

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	8 of 9



Picture 6: Ludlow cleaning up the section of Maiden Lane located in front of the 114 Maiden Lane driveway with a Broce Broom. View to the southeast.

Res. Representative:	J. Meunier	Date:	6/28/22
-----------------------------	------------	--------------	---------

Daily Report

Project:	Durham Meadows Pipeline Installation	Date:	June 28, 2022
Location:	Maple Avenue and Maiden Lane, Durham	Day of Week:	Tuesday
Project #:	AECOM: 6061487	Report No:	456
Contractor:	Ludlow Construction	Page:	9 of 9



Picture 7: Ludlow raking out loam and placing grass seed to the northwest side of the 114 Maiden Lane residence where the lawn was disturbed during the installation of a 2" copper water service line.