AFCOM

Daily Report

Project: September 29, 2022 **Durham Meadows Pipeline Installation** Date:

Day of Week: Thursday Location: Maple Avenue and Maiden Lane, Durham

AECOM: 6061487 **Report No:** 519 Project #:

Page: 1 of 9 **Contractor: Ludlow Construction**

Weather Conditions

Conditions: Daylight hours: Sunny. Wind variable 0-6 mph.

Temperature (°F): High 71°F Low 44°F

Conti	act	ors	& Sı	ubcontractors Workforce
Trade	#	х	hrs	Trade
USACE				Ludlow Construction
Field Engineer	1	Х	8	Superintendent
				Safety Officer
United Concrete	0	Х	8	Foreman
West State Mechanical	0	Χ	8	Dump truck Operator
Northeast Rigging	0	Χ	8	Excavator Operator
Grela	2	Χ	8	Skid Steer/Bucket Loa
Fazzino Plumbing	0	Χ	8	Laborers
United Concrete	0	Χ	8	Note that some persons operat
Knapp Engineering	0	Х	8	Multiple pieces equipment.
Apuzzo Electric	0	Х	8	
Geophysical Applications	1	Х	8	Sub-contractor
A&R Electrical	0	Х	8	Municipal Police Deta
· · · · · · · · · · · · · · · · · · ·	1			

CONTROLCE WORKSTORE			
Trade	#	Χ	hrs
Ludlow Construction			
Superintendent	0	Χ	8
Safety Officer	1	Χ	8
Foreman	1	Χ	8
Dump truck Operator	1	Χ	8
Excavator Operator	1	Χ	8
Skid Steer/Bucket Loader	1	Χ	8
Laborers	2	Χ	8
Note that some persons operate			
Multiple pieces equipment.			
Sub-contractor	2	Χ	8
Municipal Police Detail	0	Χ	8
State Police Detail	0	Χ	8

Equipment in Use				
Туре	#	х	Hr	s
Concrete/Asphalt Road Saw	0	Х	8	
Dump truck	1	Х	8	
Excavator – Large	1	Х	8	
Excavator - Mid-Size	0	Х	8	
Excavator - Rubber Wheeled	0	Х	8	
Skid Steer / Bucket Loader	0	Х	8	
Rolling Compactor	0	Х	8	
Plate Compactor	0	Х	8	
Jumping Jack Compactor	1	Х	8	
Street Sweeper (Broce Broom)	0	Х	8	
Material Hopper	0	Х	8	
Cutoff saw	1	Х	8	
Light Tower	0	Х	8	8

Visitors: None.

Pipe Connections, Installations, and Other Work

Ludlow continued to address a leak in the foundation of the 24 Maiden Lane, Durham, residence. Ludlow began to place loam and seed on those portions of the field located west of the soccer pitch at the Coginchaug Regional High School that were previously disturbed during well decommissioning activities. Geophysical Applications began borehole assessment activities on the well located off of Mill Pond Lane, Durham.

<u>Daily Activities – foundation repair, 24 Maiden Lane, Durham</u>

Ludlow continued to address a leak in the foundation of the 24 Maiden Lane, Durham, residence.

Daily Activities - field repair, Pickett Lane, Durham

Ludlow began to place loam and seed on those portions of the field located west of the soccer pitch at the Coginchaug Regional High School that were previously disturbed during well decommissioning activities.

			2/22/22
Res. Representative:	J. Meunier	Date:	9/29/22

Daily Report

September 29, 2022 **Project: Durham Meadows Pipeline Installation** Date: Day of Week: Thursday Location: Maple Avenue and Maiden Lane, Durham **Report No:** Project #: AECOM: 6061487 519 Page: 2 of 9 **Contractor: Ludlow Construction**

<u>Daily Activities – borehole assessment, Durham</u>

Geophysical Applications began borehole assessment activities on the well located off of Mill Pond Lane, Durham.

Daily Activities – well decommissioning activities, Durham

Grela continued well decommissioning activities on the well located on the north side of the CRHS.

Res. Representative:	J. Meunier	Date:	9/29/22


Daily Report

Project:Durham Meadows Pipeline InstallationDate:September 29, 2022

Location: Maple Avenue and Maiden Lane, Durham Day of Week: Thursday

Project #: AECOM: 6061487 **Report No:** 519

Contractor: Ludlow Construction Page: 3 of 9

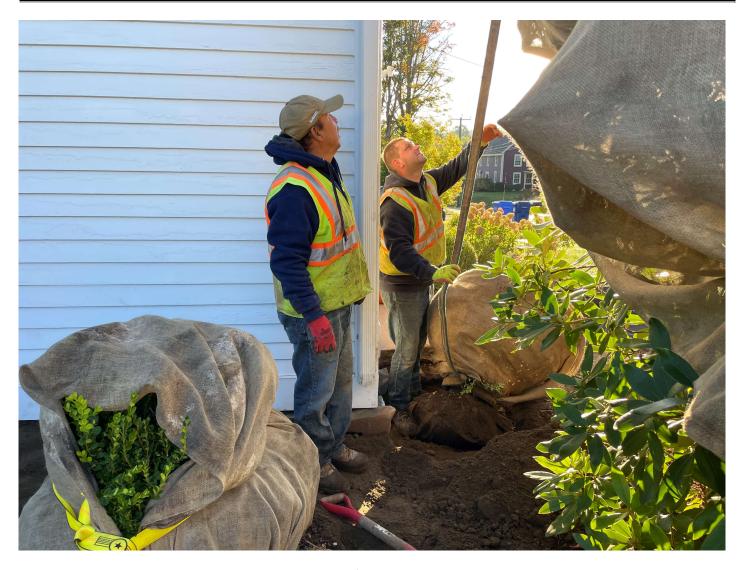

Picture 1: Ludlow replacing a shrub on the southwest corner of the 24 Maiden Lane, Durham, residence. View to the southeast.

Res. Representative:	J. Meunier	Date:	9/29/22

Daily Report

Project: Durham Meadows Pipeline Installation **Date:** September 29, 2022

Location: Maple Avenue and Maiden Lane, Durham Day of Week: Thursday

Project #: AECOM: 6061487 **Report No:** 519

Contractor: Ludlow Construction 4 of 9



Picture 2: Ludlow placing mulch on the southwest corner of the 24 Maiden Lane, Durham, residence. View to the north.

Daily Report

Project: Durham Meadows Pipeline Installation **Date:** September 29, 2022

Location: Maple Avenue and Maiden Lane, Durham Day of Week: Thursday

Project #: AECOM: 6061487 **Report No:** 519

Page: 5 of 9

Contractor: Ludlow Construction



Picture 3: Geophysical Applications performing borehole assessment activities on the well located at the Hill Hollow condominium complex in Durham. View to the southwest.

Res. Representative:	J. Meunier	Date:	9/29/22

Daily Report

Project: Durham Meadows Pipeline Installation **Date:** September 29, 2022

Location: Maple Avenue and Maiden Lane, Durham Day of Week: Thursday

Project #: AECOM: 6061487 **Report No:** 519

Page: 6 of 9

Contractor: Ludlow Construction



Picture 4: Grela measuring the depth to the top of the bentonite chips they placed in the well located on the north side of the CRHS yesterday before placing additional chips into the well. View to the southwest.

Res. Representative:	J. Meunier	Date:	9/29/22


Daily Report

Project: Durham Meadows Pipeline Installation **Date:** September 29, 2022

Location: Maple Avenue and Maiden Lane, Durham Day of Week: Thursday

Project #: AECOM: 6061487 **Report No:** 519

Contractor: Ludlow Construction Page: 7 of 9

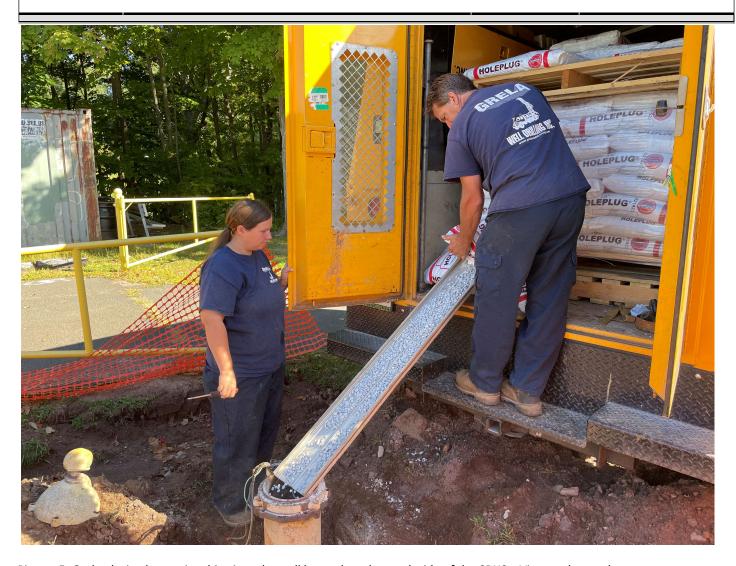

Picture 5: Grela placing bentonite chips into the well located on the north side of the CRHS. View to the northeast.

Res. Representative:	J. Meunier	Date:	9/29/22

Daily Report

Project: Durham Meadows Pipeline Installation **Date:** September 29, 2022

Location: Maple Avenue and Maiden Lane, Durham Day of Week: Thursday

Project #: AECOM: 6061487 **Report No:** 519

Page: 8 of 9

Contractor: Ludlow Construction



Picture 6: Ludlow raking out loam that they placed on the west side of the CRHS soccer field to repair those sections of the field that were disturbed during the decommissioning of a well by Grela. View to the southeast.

Res. Representative:	J. Meunier	Date:	9/29/22

Daily Report

Project: Durham Meadows Pipeline Installation **Date:** September 29, 2022

Location: Maple Avenue and Maiden Lane, Durham Day of Week: Thursday

Project #: AECOM: 6061487 **Report No:** 519

Contractor: Ludlow Construction Page: 9 of 9



Picture 7: Geophysical Applications decontaminating the cable used to lower probes into the well located at the Hill Hollow condominium complex in Durham.

Res. Representative:	J. Meunier	Date:	9/29/22